



12 South Center Street  
Bensenville, IL 60106

Office: 630.350.3404  
Fax: 630.350.3438  
[www.bensenville.il.us](http://www.bensenville.il.us)

**VILLAGE BOARD**

**President**  
Frank Soto

**Board of Trustees**  
Rosa Carmona  
Frank DeSimone  
Annie Jaworska  
David Majewski  
Martin O'Connell  
Henry Wasseleer

**Village Clerk**  
Ilsa Rivera-Trujillo

**Village Manager**  
Evan K. Summers

October 14, 2016

Ms. Anna Boone  
17845 William Street  
Lansing, Illinois 60438

Re: October 13, Commercial 2016 FOIA Request

Dear Ms. Boone:

I am pleased to help you with your October 13, 2016 Commercial Freedom of Information Act ("FOIA"). Your request was received by the Village of Bensenville on October 13, 2016. You requested copies of the items indicated below:

*"Please forward and documents listing any code violations against the property located at 9\*23 John St, Bensenville, IL."*

After a search of Village files, the following documents are enclosed to fulfill your request:

- 1) Village of Bensenville Inspection number 45866. (2 pgs.)

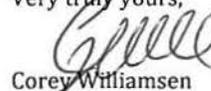
These are all of the documents that can be discovered responsive to your request.

Section 7(1)(b) of FOIA provided that "private information" is exempt from disclosure. "Private information" is defined in FOIA as, "unique identifiers, including a person's social security number, driver's license number, employee identification number, biometric identifiers, personal financial information, passwords or other access codes, medical records, home or personal telephone numbers, and personal email addresses. Private information also includes home address and personal license plates, except as otherwise provided by law or when complied without possibility of attribution to any person." 5ILCS 140/2(c-5). Consequently, certain unique identifiers have been redacted from the records being provided.

Pursuant to Section 9 of the FOIA, 5 ILCS 140/9, I am required to advise you that I, the undersigned Freedom of Information Officer, reviewed and in consultation with an attorney for the Village, made the foregoing determination to deny a portion of your FOIA Request as indicated. Should you believe that this Response constitutes an improper denial of your request, you may appeal such by filing a request for review within sixty (60) days of the date of this letter with the Public Access Counselor of the Illinois Attorney General's Office, Public Access Bureau, 500 South Second Street, Springfield, Illinois 62706; telephone 1-887-299-FOIA; e-mail: [publicaccess@atg.state.il.us](mailto:publicaccess@atg.state.il.us). You may also have a right of judicial review of the denial under Section 11 of FOIA, 5 ILCS 140/11.

Do not hesitate to contact me if you have any questions or concerns in connection with this response.

Very truly yours,

  
Corey Williamsen  
Freedom of Information Officer  
Village of Bensenville



**VILLAGE OF BENSENVILLE**  
**INSPECTIONAL SERVICES**  
 12 South Center  
 Bensenville, IL 60106  
 630-350-3413 fax:630-350-3449

Type of Inspection: RETI: TRANSFER INSPECTION

**CORRECTION NOTICE**

Address: 923 JOHN

Unit:

Business name::

Phone: 

Business Owner:

Address:

Inspection Date: 08-31-16

Inspector: RON HERFF

<u>Checklist #</u>	<u>Violation</u>	<u>Violation comment</u>
010Z	OTHER	
020A	GRASS HEIGHT EXCEEDS 8 INCHES	
020B	WEED HEIGHT EXCEEDS 8 INCHES	
030A	REPAIR/REPLACE DRIVEWAY OR APRON	Driveway must be repaired/replaced
050E	GFCI ALL EXTERIOR RECEPTACLES	All exterior outlets must be GFCI style outlets
050F	FASCIA/SOFFIT NEEDS ATTENTION	Soffit and Fascia on house and garage must be repaired
050G	REPAIR OR REPLACE DAMAGED ROOF	The roof on the house and garage must be replaced.
050R	EXTERIOR GAS SUPPLY	GAS is shut off to the home.
060C	MEANS OF EGRESS BLOCKED	The dead bolt locks on the exit doors of the home do not operate. Must be repaired/replaced or removed.
080	ACCESSORY STRUCTURE	The detached garage is in very bad shape. All doors must be boarded up ASAP. The garage may have to be demolished. The roof and walls are beginning to cave in.
080A	REPAIR OR REPLACE FENCE	The wood fence in the back yard is damaged.
080C	SCRAPE AND REPAINT SURFACE	The entire home inside and out needs to be scraped and painted. The garage also needs to be painted
090B	FREE AREA OF MOLD OR MILDEW	There is mold in the main floor bathroom.
090D	REPAIR HOLES IN WALL / CEILING	There are many holes in the walls and ceiling of the home.
120D	REPLACE PAINTED OUTLETS	All painted outlets must be replaced. Must also replace all non-grounded outlets.
120F	INSTALL REQUIRED GFCI OUTLETS	GFCI outlets are required for all outlets at counter height.
120I	NEED ACCESS TO ELECTRIC PANEL	There are open circuits in the electric panel. The circuits must be labeled.
120K	COVER ALL OPEN JUNCTION BOXES	There are many open junction boxes in the home.
120M	REMOVE ALL EXTENSION CORDS	All extension cords must be removed: See stove and extension cord from the basement to first floor running up thru a hole in the floor.
120O	FLUORESCENT FIXTURE IN CLOSETS	Screw in type light bulbs are no longer acceptable in closets
120R	WATER HEATER NEED TO BE BONDED	
120S	WATER METER NEEDS JUMPER WIRE	WATER IS SHUT OFF TO THE HOME. There is also a Private water well operating in the basement of the home.
140C	IMPROPER GAS SUPPLY LINE	Gas line for stove must be undated.
150D	BATHROOM NEEDS EXHAUST FAN	Unable to check.
150F	IMPROPER PITCH ON FLUE	Flue pipe for water heater is not pitched correctly Flue pipe for furnace must be replaced, it is rusted and has many holes
150G	IMPROPER EXHAUST VENT	There is no exhaust vent in the kitchen



VILLAGE OF BENSENVILLE
INSPECTIONAL SERVICES
12 South Center
Bensenville, IL 60106
630-350-3413 fax:630-350-3449

Type of Inspection: RETI: TRANSFER INSPECTION

CORRECTION NOTICE

Address: 923 JOHN

Unit:

Business name::

Phone: [Redacted]

Business Owner:

Address:

Inspection Date: 08-31-16

Inspector: RON HERFF

160A SMOKE DETECTORS NEEDED

Smoke detectors are required in every bed room. An A/C powered smoke detector is required in main hall with in 15 foot of a sleeping area. A smoke detector is also required on every level of the home.

160B CARBON MONOXIDE NEEDED

A CO detector is required with in 15 feet of a sleeping area.

185A SLEEPING AREA PROHIBITED

The basement may not be used as a sleeping area.

Additional Remarks/Comments:

Re-inspection is required with-in 30 days.

Reinspection 45934 created on 08/31/2016 by 6523rher

THOSE ITEMS LISTED ABOVE ARE VIOLATIONS OF BENSENVILLE'S ADOPTED VILLAGE CODE AND/OR PROPERTY MAINTENANCE CODE. THIS IS YOUR WRITTEN "CORRECTION NOTICE". FAILURE TO CORRECT THE ABOVE LISTED VIOLATIONS WITHIN THE PRESCRIBED TIME CAN RESULT IN A FINE OF UP TO \$750 PER VIOLATION, PER DAY.

You are hereby notified to remedy the conditions as stated above within 30 days from the date of this order. Appeal from this order may be made within 20 days from the above date of service. Direct such appeal for a hearing before the Bensenville Board of Appeals in writing through the Director of Inspectional Services, 12 South Center.

Neither this inspection nor any Certificate of Occupancy issued by the Village of Bensenville shall be considered a complete list of Code or Municipal Ordinances. Our inspection can be substantially limited by access available and stored items or furniture. Some occupancies may require inspections to be completed on individual systems such as heating appliances, roofing, structure or fire protection systems. If you have questions about this inspection, please call 630-350-3448.

DISCLAIMER: The Village of Bensenville does not warrant the condition of any property inspected and disclaims all liability for any claims arising out of the property or condition thereof.

Copy of this report received by/mailed to: \_\_\_\_\_

Inspector: \_\_\_\_\_ Date: \_\_\_\_\_